


NOTES:

1. WIRING IS SHOWN FOR CW-IS-FWD.
IF CCW-IS-FWD, P4 IS REVERSED,
P3-3 CONNECTS TO S3 AND P3-1 CONNECTS TO S4.
2. FIELD WIRING TERMINAL: #
3. SET CONTROL BOARD FEEDBACK SELECTION JUMPER J5/J6
TO J-J5 FOR 2-WIRE OR J-J6 FOR 4-WIRE FEEDBACK.
4. * 2-WIRE CONNECTION:
FOR 24-35 VDC SUPPLY, TERMINAL 15 IS POSITIVE.
FOR 36-45 VDC SUPPLY, TERMINAL 15 IS NEGATIVE.
5. **SEE INSTRUCTION MANUAL FOR SPECIFIC CONFIGURATIONS.

AUXILIARY SWITCHES

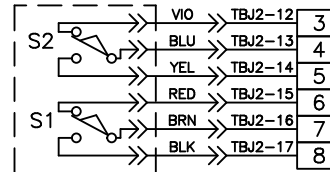

17-3011-05o -

SIZE:
A

THIS DOCUMENT IS A COPY AND IS NOT THE SOURCE DOCUMENT. INFORMATION IS SUBJECT TO CHANGE WITHOUT NOTICE. THE INFORMATION CONTAINED HEREIN IS COPYRIGHTED BY HAROLD BECK AND SONS, INC. CHANGES TO THE DOCUMENT ARE PROHIBITED. CONTACT A BECK SALES ENGINEER IF A CERTIFIED DRAWING IS REQUIRED.

HAROLD BECK & SONS INC

NEWTOWN INDUSTRIAL COMMONS NEWTOWN, PENNSYLVANIA 18940 USA

TITLE:

WIRING DIAGRAM GROUP 31 OPTION 3
120 VOLT 2 AUX SWITCHES MA/VDC
MODULATING CONTROL 5X20 FUSE

DRAWN:
GMD 12/1/15

SCALE:
NONE

DRAWING NO:

REV:

CHECKED:
BDP 12/8/15

17-3011-05o

-

APPROVED:
FWB 1/19/16

SHEET NO. 1 OF 1