


**NOTES:**

1. WIRING IS SHOWN FOR EXTEND-IS-FWD.  
IF RETRACT-IS-FWD, P4 IS REVERSED,  
P3-3 CONNECTS TO S3 AND P3-1 CONNECTS TO S4.
2. FIELD WIRING TERMINAL: #
3. SET CONTROL BOARD FEEDBACK SELECTION JUMPER J5/J6  
TO J-J5 FOR 2-WIRE OR J-J6 FOR 4-WIRE FEEDBACK.
4. \* 2-WIRE CONNECTION:  
FOR 24-35 VDC SUPPLY, TERMINAL 15 IS POSITIVE.  
FOR 36-45 VDC SUPPLY, TERMINAL 15 IS NEGATIVE.

**AUXILIARY SWITCHES**

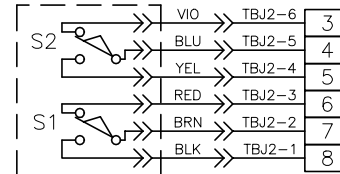

17-4207-02o B

SIZE:  
**A**

## HAROLD BECK & SONS INC

NEWTOWN INDUSTRIAL COMMONS NEWTOWN, PENNSYLVANIA 18940 USA

TITLE:

**WIRING DIAGRAM GROUP 42-XX7  
120 VOLT 2 AUX SWITCHES**

DRAWN:  
CHH 9-28-05

SCALE:  
NONE

DRAWING NO:

REV:

CHECKED:  
BDP 10-18-05

**17-4207-02o**

**B**

APPROVED:  
JHM 10/18/05

SHEET NO. 1 OF 1

THIS DOCUMENT IS A COPY AND IS NOT THE SOURCE DOCUMENT. INFORMATION IS SUBJECT TO CHANGE WITHOUT NOTICE. THE INFORMATION CONTAINED HEREIN IS COPYRIGHTED BY HAROLD BECK AND SONS, INC. CHANGES TO THE DOCUMENT ARE PROHIBITED. CONTACT A BECK SALES ENGINEER IF A CERTIFIED DRAWING IS REQUIRED.