


NOTES:

1. WIRING IS SHOWN FOR EXTEND-IS-FWD.
IF RETRACT-IS-FWD, P4 IS REVERSED.
2. FIELD WIRING TERMINAL: #
3. SET CONTROL BOARD FEEDBACK SELECTION JUMPER J5/J6 TO J-J5 FOR 2-WIRE OR J-J6 FOR 4-WIRE FEEDBACK.
4. * 2-WIRE CONNECTION:
FOR 24-35 VDC SUPPLY, TERMINAL 15 IS POSITIVE.
FOR 36-45 VDC SUPPLY, TERMINAL 15 IS NEGATIVE.
5. **SEE INSTRUCTION MANUAL FOR SPECIFIC CONFIGURATIONS.


TERMINAL CONNECTIONS FOR REMOTE CONTROL:

EXTEND	LINE TO EXTEND
RETRACT	LINE TO RETRACT
STOP	NONE

UNUSED



AUXILIARY SWITCHES

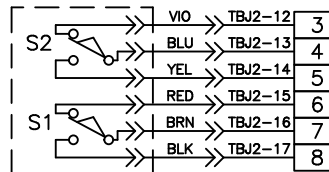

17-4215-02o -

SIZE:
A

HAROLD BECK & SONS INC

NEWTOWN INDUSTRIAL COMMONS NEWTOWN, PENNSYLVANIA 18940 USA

TITLE:

WIRING DIAGRAM GROUP 42-XX5
120 VOLT 2 AUX SWITCHES
5X20 FUSE

DRAWN:
GMD 12/8/15

SCALE:
NONE

DRAWING NO:

REV:

CHECKED:
BDP 12/8/15

17-4215-02o

-

APPROVED:
FWB 1/19/16

SHEET NO. 1 OF 1

THIS DOCUMENT IS A COPY AND IS NOT THE SOURCE DOCUMENT. INFORMATION IS SUBJECT TO CHANGE WITHOUT NOTICE. THE INFORMATION CONTAINED HEREIN IS COPYRIGHTED BY HAROLD BECK AND SONS, INC. CHANGES TO THE DOCUMENT ARE PROHIBITED. CONTACT A BECK SALES ENGINEER IF A CERTIFIED DRAWING IS REQUIRED.